

3. STARTING THE SENSOR

NOTE: The Gocator sensor must be connected to a host computer in order to launch the user interface and set up the sensor. Gocator sensors are configured by connecting with a web browser. For details on browser compatibility, see the user manual.

A. LAUNCHING THE INTERFACE

Step 1

Apply power to the sensor.

Step 2

Change network setting on the *host computer*.

In Windows 10

- From the Start menu, launch the Settings app and click **Network & Internet**, and then click **Change adapter options** under Advanced network settings..
- Right-click desired network connection, and then click **Properties**.
- On the Networking tab, click **Internet Protocol Version 4 (TCP/IPv4)**, and then click **Properties**.
- Select "Use the following IP address" option.
- Enter IP Address "192.168.1.5" and Subnet Mask "255.255.255.0", then click **OK**.

In Mac OS 11

- Click Apple menu > **System Preferences**, and then click **Network**.
- In the list to the left, select **Ethernet**.
- Click **Advanced**, click **Hardware**, click the **Configure** pop-up menu, and set it to "Manually".
- Enter IP Address "192.168.1.5" and Subnet Mask "255.255.255.0", and then click **Apply**.

Gocator sensors are shipped with the following default network configuration:


Setting	Default
DCHP	Disabled
IP Address	192.168.1.10
Subnet Mask	255.255.255.0
Gateway	0.0.0.0

Step 3

Apply power to the sensor.

Step 4

Open a web browser and enter the sensor address.

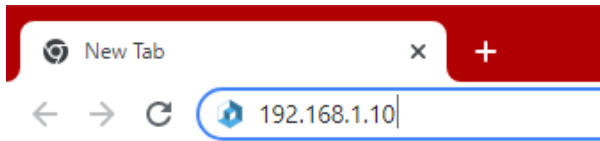

The sensor interface loads in the browser.

B. TESTING SENSOR

Step 1

Place a target in the sensor's scan area.


Step 2

In the global toolbar, click the snapshot (single frame) button.



Step 3

In the data viewer, ensure that you see one or more profiles (target-dependent).

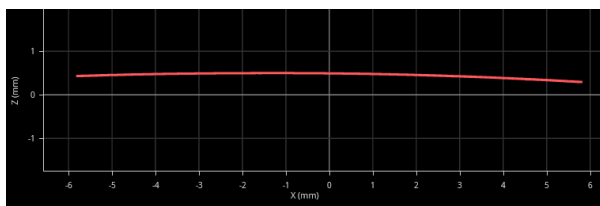

Although you can now start configuring the sensor and scanning targets for test purposes, LMI strongly recommends running Gocator 5000 sensors using a PC instance of the software (GoPxL). See *Running the Sensor on PC*, next.

C. RUNNING THE SENSOR ON PC

Step 1

On the PC connected to the sensor, download and unzip the GoPxL User Tools package.

The version of the package must match the version of GoPxL on the sensor.

Step 2

From the GoPxL_UserTools folder, launch "GoPxL x64".


A local, PC-based instance of GoPxL launches in a new tab of your default browser, using IP address 127.0.0.1.

TROUBLESHOOTING

PROBLEM	SUGGESTED RESOLUTION
Mechanical / Environmental	
The sensor is warm.	<ul style="list-style-type: none"> It is normal for a sensor to be warm when powered on.
Connection	
When connecting with a web browser, the sensor is not found (page does not load).	<ul style="list-style-type: none"> Verify the sensor power is on. This will be indicated by an illuminated POWER LED. Verify the Power & Ethernet cordset is connected to the Power/LAN connector and the Ethernet RJ45 plug is connected to the PC or a switch. Verify that the client computer's network settings are properly configured. See <i>Getting Started > Network and Sensor Setup</i> in the user manual or your computer's documentation on configuring a network adapter.
Profiling	
When the Play button is pressed, the sensor does not emit light.	<ul style="list-style-type: none"> The exposure setting may be too low. For more information, see the user manual.
The sensor emits light, but no profile displays in the data viewer.	<ul style="list-style-type: none"> Verify that the target is within the sensor's scan area (field of view and measurement range). The RANGE indicator LED on the Gocator illuminates when the target being scanned is in range. For details on the field of view and measurement range, see the user manual. Check that the exposure time is set to a reasonable level. For more information, see the user manual.


Step 3

In the browser, go to the Design panel on the System page and click **Create Scanner...**

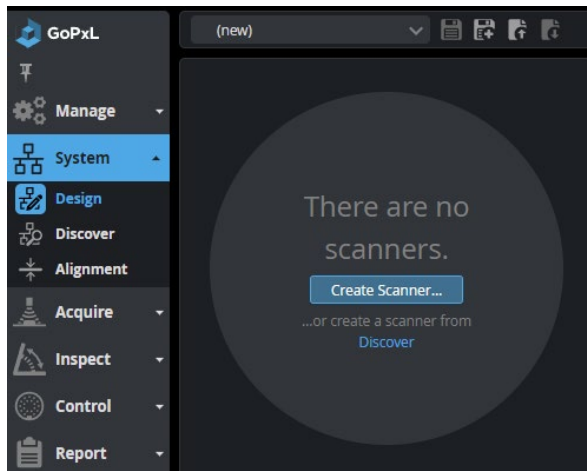

Step 4

In the Create Scanner dialog, choose Gocator Confocal Profiler in **Scan Engine**, check the Add checkbox next to the G5 sensor in the table, and click **Create**.

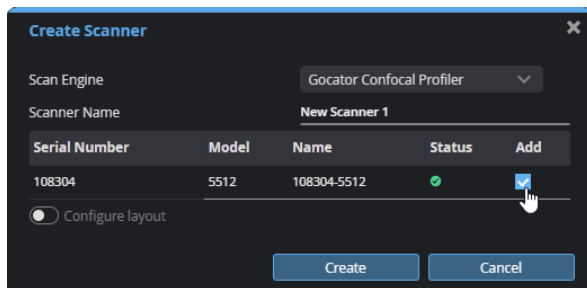

The sensor is now running through the PC instance of GoPxL.

Step 5

In the global toolbar, click the snapshot (single frame) button.




In the data viewer, ensure that you see one or more profiles (target-dependent).

D. PERFORMING WARMUP

The recommended sensor warm-up time is 30 minutes with a 50% duty cycle. To do this, do the following:


Step 1

Under **Acquire > Scanners**, expand **Trigger**, set **Source** to **Time**, and set **Frame Rate** to 500 Hz.

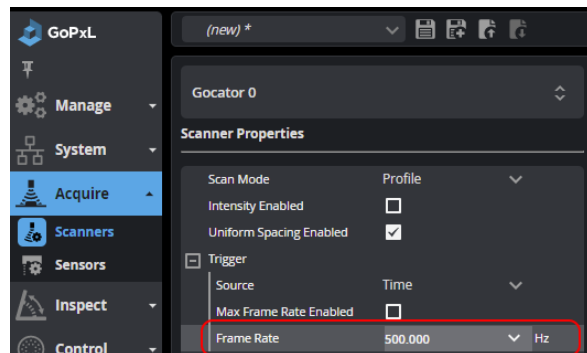

Step 2

Under **Acquire > Sensors**, set **Single Exposure** to 1000 μs.

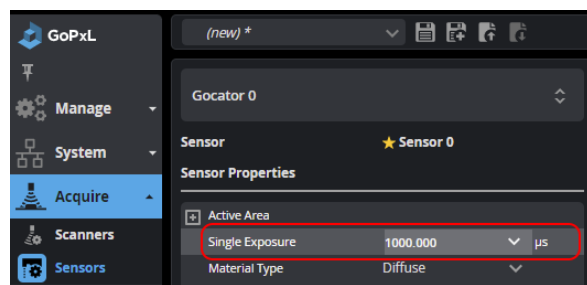

©2022 LMI Technologies Inc. All rights reserved.
 This product is designed for use solely as a component and as such it does not comply with the standards relating to laser products specified in U.S. FDA CFR Title 21 Part 1040.
 Information contained within this manual is subject to change without notice.
 Product names mentioned herein may be trademarks of their respective owners.
 Trademarks and Restrictions
 Gocator™ is a registered trademark of LMI Technologies Inc. Any other company or product names mentioned herein may be trademarks of their respective owners.
 No part of this publication may be copied, photocopied, reproduced, translated, transcribed, or reduced to any electronic medium or machine readable form without prior written consent of LMI Technologies Inc.
 LMI Technologies Inc.
 This document, submitted in confidence, contains proprietary information which shall not be reproduced or transferred to other documents or disclosed to others or used for manufacturing or any other purpose without prior written permission of LMI Technologies Inc.

LMI Technologies has sales offices and distributors worldwide. All contact information is listed at lmi3d.com/contact/.
 Americas
 LMI Technologies (Head Office)
 Vancouver, Canada
 +1 604 636 1011
 LMI Technologies GmbH
 Berlin, Germany
 +49 (0)3328 9360 0
 Asia Pacific
 LMI (Shanghai) Trading Co., Ltd.
 Shanghai, China
 +86 21 5441 0711



Gocator 5500

Quick Start Guide




For the user manual, CAD drawings, firmware release notes, SDK, and more, go to lmi3d.com/product-downloads.

15267.01.01_Manual_Quickstart_Gocator_5500_Series

GOCATOR OVERVIEW

Each sensor model in the Gocator 5000 series is designed with a unique Clearance Distance (CD), Measurement Range (MR) and Field of View (FOV). Models have different types and locations of mounting holes. Refer to the sensors specifications for more information about your model. (Model shown is Gocator 5512 / 5513.)

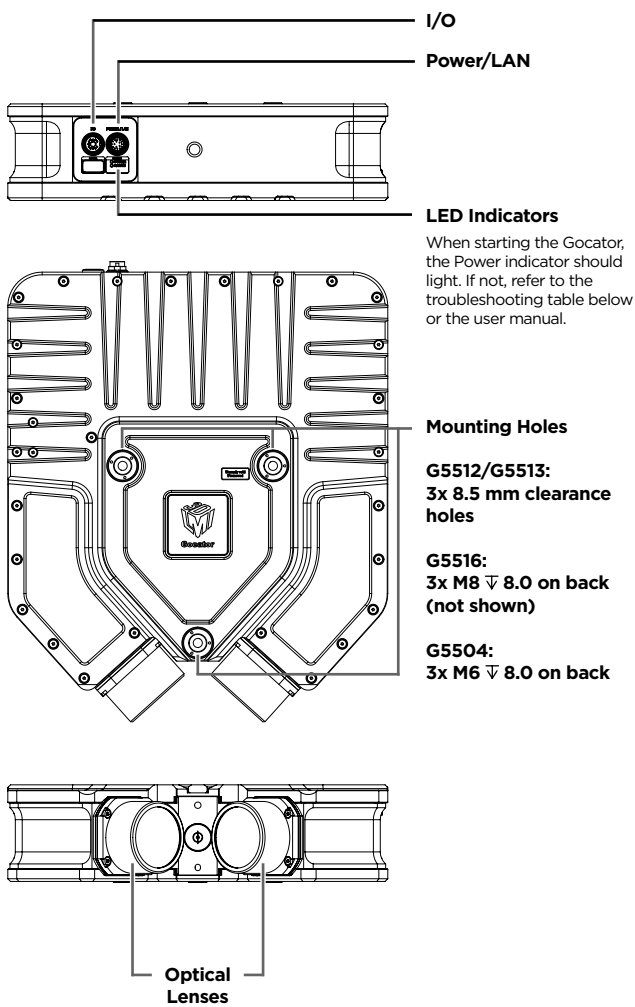

GROUNDING GOCATOR

Gocator housings should be grounded to the earth and the grounding shield of the Gocator I/O cordsets. Gocator 5000 sensors are designed to provide adequate grounding through the mounting surfaces and screws. Always check grounding with a multimeter to ensure electrical continuity between the mounting frame and the Gocator connectors.

The frame or electrical cabinet that the Gocator is mounted to **must** be connected to **earth ground**.

GROUNDING CORDSET (RECOMMENDED)

To minimize interference with other equipment, the High Power & Ethernet cordset can be grounded by terminating the cordset shield before the split. The most effective grounding method is to use a 360-degree clamp. For instructions, see the user manual.

ELECTRICAL SAFETY

Minimize voltage potential between system ground (ground reference for I/O signals) and sensor ground
Use shielded cables with shield grounded at both ends. Sensor housing should be connected to earth ground.

Use a suitable power supply

The +24-48V power supply used with Gocator 5000 sensors should be an isolated supply with inrush current protection.

Use care when handling powered devices

Wires connecting to the sensor should not be handled while the sensor is powered. Doing so may cause electrical shock to the user or damage to the equipment.



Failure to adhere to the guidelines described in this section may result in electrical shock or equipment damage.


1. MOUNTING

NOTE: Due to the weight of the sensors, LMI recommends that two people mount or move the devices.

NOTE: Mounting the sensor is recommended before applying power. Ensure that a proper earth ground is established.


Gocator 5504

Use three M6 screws, hole depth of 8 mm.

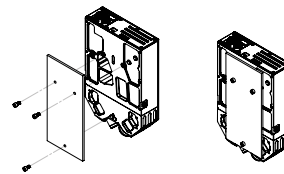


Gocator 5512 / 5513

Use three M8 DIN912 or 5/16" socket head cap screw ANSI/ASME B18.3, minimum lengths 90mm or 3.5. Front mounting only.

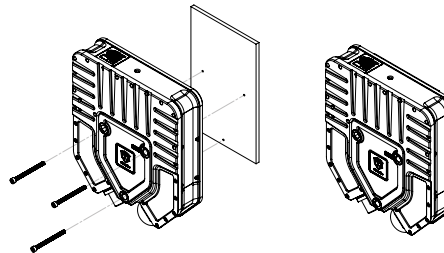

Gocator 5516


Use three M8x1.25 screws. Hole depth of 8 mm.

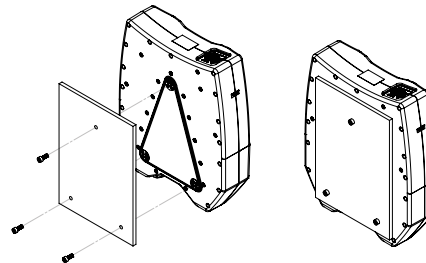

Ensure that targets will be within the sensor's scan area. For more information, see the sensor specifications.

2. CONNECTING GOCATOR TO A HOST COMPUTER

Standalone System

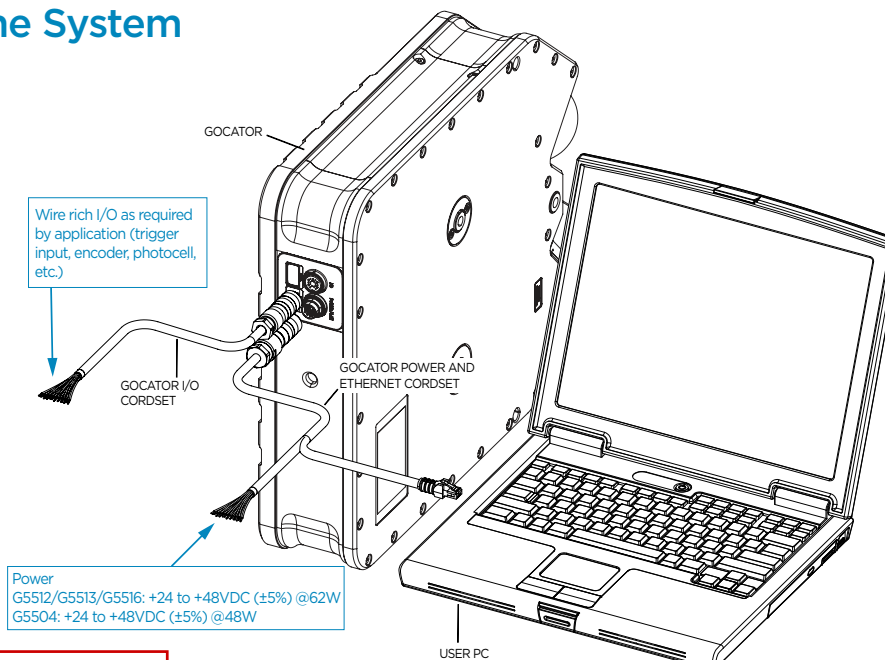

Connector Pin Details

Power/LAN		Pin	Function	Conductor Color
O	E	L	24-48V (MAIN)*	Grey/Red
D	F	M	GND_24-48V (MAIN)**	Grey/Black
C	G	L	24-48V (MAIN)*	Pink/Red
N	H	M	GND_24-48V (MAIN)**	Pink/Black
B	I	A	24-48V (AUX)*	Red
A	R	N	GND_24-48V (AUX)**	Black
M	K	A	24-48V (AUX)*	Orange/Red
L	L	N	GND_24-48V (AUX)**	Orange/Black
K	M	B	24-48V (AUX)*	Yellow/Red
J	N	C	GND_24-48V (AUX)**	Yellow/Black
I	O	O	-	White/Red
H	P	D	-	White/Black
G	Q	E	Ethernet MX1+	Violet/Red
F	R	F	Ethernet MX1-	Violet/Black
E	S	G	Ethernet MX2+	Green/Red
D	T	H	Ethernet MX2-	Green/Black
C	U	R	Ethernet MX3-	Blue/Red
B	V	P	Ethernet MX3+	Blue/Black
A	W	I	Ethernet MX4+	Brown/Red
Z	X	K	Ethernet MX4-	Brown/Black

*All 24-48V wires (MAIN and AUX) are soldered together.

**All GND_24-48V (MAIN and AUX) wires are soldered together.

I/O		Pin	Function	Conductor Color
D	F	D	Trigger_in+	Blue/Red
H	R	H	Trigger_in-	Blue/Black
N	P	N	Out_1+ (Digital Output 0)	Brown/Red
O	E	O	Out_1- (Digital Output 0)	Brown/Black
S	D	S	Out_2+ (Digital Output 1)	Green/Red
T	O	T	Out_2- (Digital Output 1)	Green/Black
M	C	M	Encoder_A+	Pink/Red
U	N	U	Encoder_A-	Pink/Black
I	B	I	Encoder_B+	Yellow/Red
K	A	K	Encoder_B-	Yellow/Black
A	Z	A	Encoder_Z+	White/Red
L	M	L	Encoder_Z-	White/Black
B	U	B	Serial_out+	Purple/Red
C	L	C	Serial_out-	Purple/Black
E	M	E	Reserved	Red
G	N	G	Reserved	Black
P	O	P	Reserved	Gray/Red
F	P	F	Reserved	Gray/Black & Orange/Black
R	Q	R	Reserved	Orange/Red (not connected)